Ribbon Star Supreme LED Strip Light - 12VDC


SKU: RL-SC-RSS



255 Distribution Dr. #104 Sparks, NV 89441, USA ECOLOCITYLED.COM **7 7 5 - 6 3 6 - 6 0 6 0**



SPECIFICATIONS

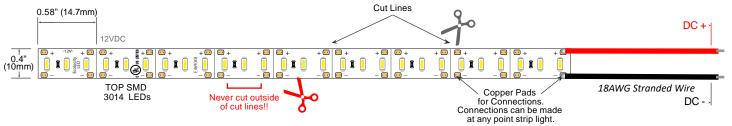

Product SKU: RL-SC-RSS LED Size: 3014 SMD

LED Quantity: 3 LEDs per 0.58"

Input Power: 12VDC Constant Voltage

Watts: 9.5W per foot

Max Serial Connection: 12ft

Operating Temp: -4° ~ 113°F

Beam Angle: 120°

Rating: Dry

Warranty Period: 2 Years

Input Power: 12VDC Constant Voltage

Power supply equation

X * 9.50 = Y

X = linear strip light footage

Y = minimum transformer wattage

<u>Precautions</u>



WARNING - This product should be installed, cut and connected only by a qualified professional.



NEVER cut, connect, or join wires while product is connected to a live power source.



Use 12VDC Input Only!



DO NOT bend or crease the strip in a manner that will damage the conductivity of the circuit board.



DO NOT use AC Input!



DO NOT use in direct sunlight.
DO NOT use in environments over 113°F.
DO install on a metal heat sink.



This product is not designed to be installed in wet or damp environments.



DO NOT exceed 12ft serial connection! BE CERTAIN your 12VDC source and wire gauge is suffice for powered load.

EcolocityLED.com info@EcolocityLED.com



Ribbon Star Supreme LED Strip Light - 12VDC

SKU: RL-SC-RSS

INSTALLATION





1.) Clean Mounting Surface



Use your cleaning supplies to clean your mounting surface. Please note that mounting surface must be smooth, clean and dry for the 3M tape to permanently adhere.

2.) Connect Transformer



WARNING – This step should be done by a qualified professional. Always disable AC power before connecting! Use wire nuts or connectors to secure your AC input to your 12V transformer.

3.) Connect Strip Lights




Always be certain power is disabled before connecting! Use wire nuts, connectors, or solder and heat shrink to secure your 12V DC+ and DC- output wires to your LED Strip Light.

4.) Test and Mount Strip Lights



Always test your strip lights before adhering the 3M double sided tape. Never test the strip light when rolled inside the plastic reel.

CONNECTION EXAMPLES: 9.50 Watts per foot

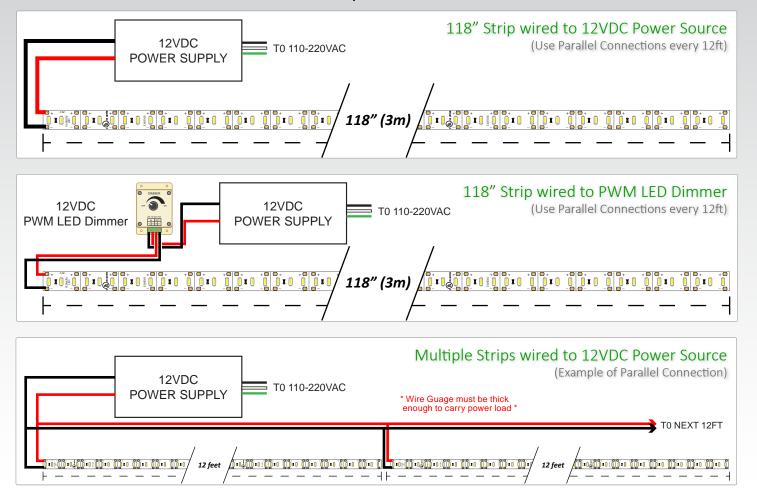

Ribbon Star Supreme LED Strip Light - 12VDC

SKU: RL-SC-RSS

SOLDERING INSTRUCTION






1.) Strip and Tin Wire




Heat your soldering iron to 500-600°F. Strip your 2 conductor stranded wire roughly 1/8". Tin the exposed wires with rosin core solder.

2.) Tin Strip Light Pads



Cut your strip light to length on cut line between copper pads then secure with masking tape. Tin each copper pad with rosin core solder.

3.) Solder Wire to Strip



Mate your tinned wire to the copper pad with respective polarity. Red wire to DC+ (positive), Black wire to DC - (negative).

4.) Test and Heat Shrink



Test your soldered connection for continuity or any electrical arcing. Once tested you can cover exposed copper pads with heat shrink if desired.

STRIP LIGHT ACCESSORIES:



NO CONNECTORS (Strip light must be soldered)



12VDC Power Supplies



PWM LED Dimmers



Aluminium Extrusions and Covers

HELPFUL LINKS:

12VDC Power Supplies - http://www.ecolocityled.com/category/led_power_supplies_12v
PWM LED Dimmers - http://www.ecolocityled.com/category/pwm_led_light_dimmer
18AWG Connection Wire - http://www.ecolocityled.com/product/50ft_dc_connection_wire_bonded
Aluminium Extrusions - http://www.ecolocityled.com/category/led_aluminum_extrusions
Strip Light Soldering Guide - http://www.ecolocityled.com/category/led_tutorials_dc_solder

